Bicycle_Pedal_and_Crank

Given a c3d file with one marker on each pedal of a stationary bicycle, create crank and pedal segments.

The tutorial files can be found here

Open the Movement Trial

Open the file Pedal_Motion.c3d

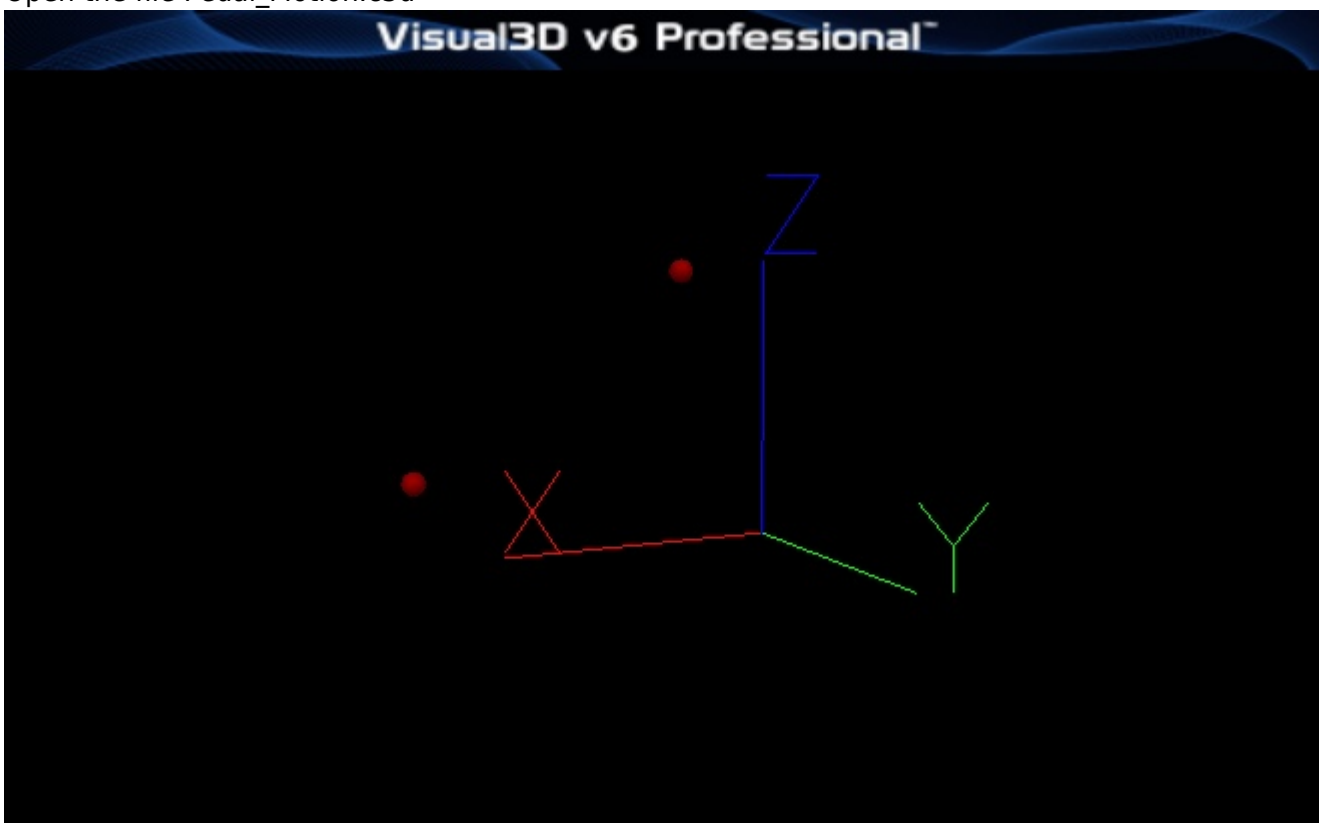

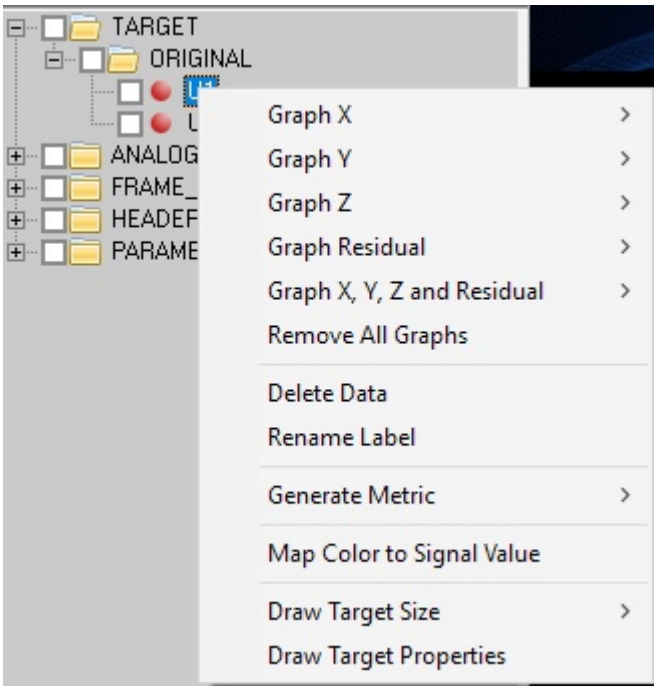

Note that there are only two markers.

Highlight the path of the markers as trails. Select the TARGET u1 with a right mouse click. Select the option “Draw Target Properties”

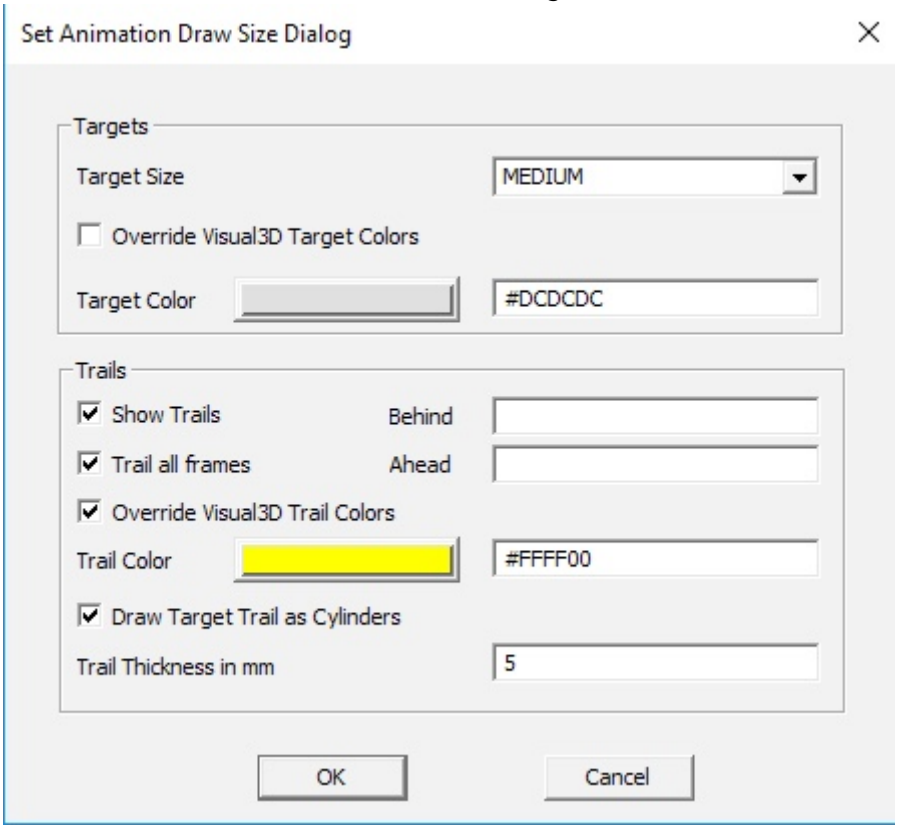

Select the options to draw the trail and specify the color.

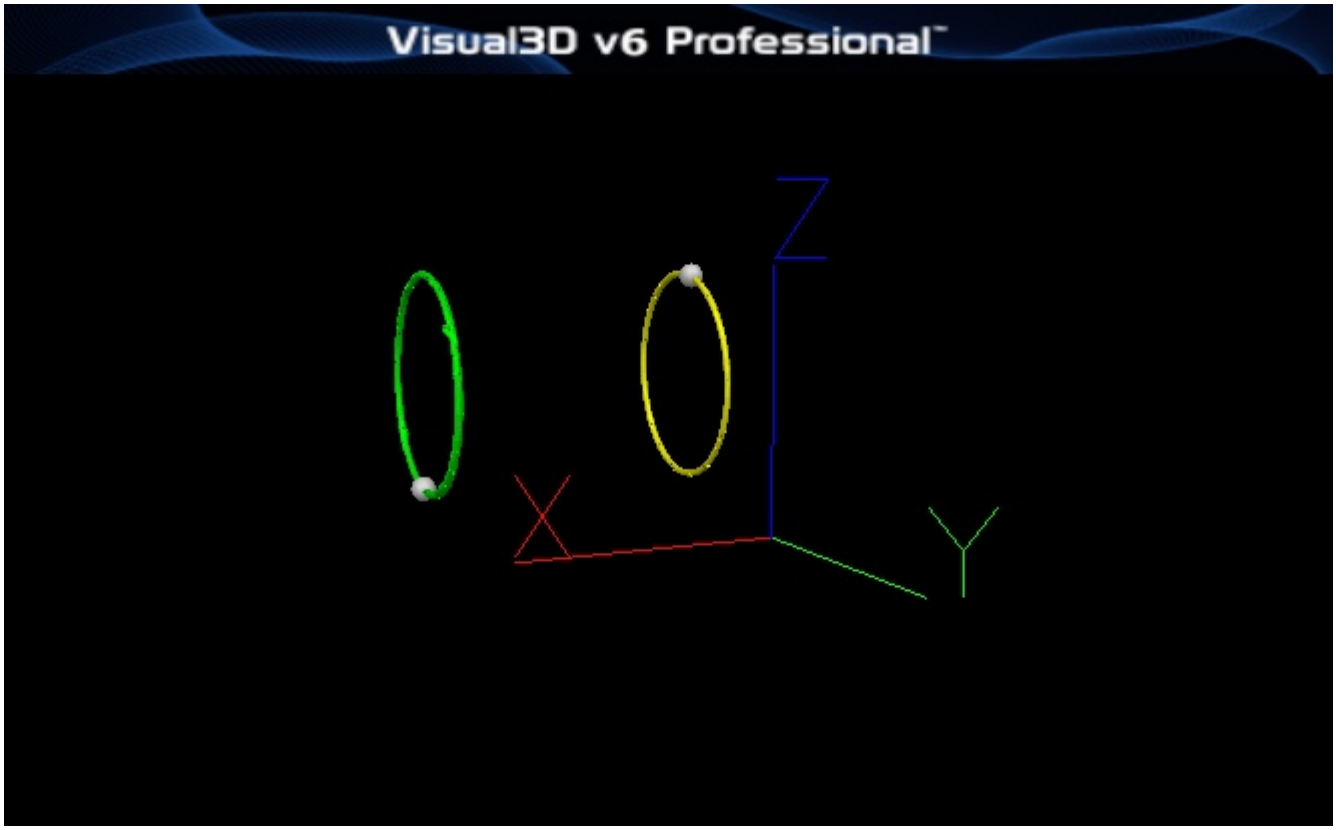

The circular path of each marker should be drawn in the animation.

Create the Model

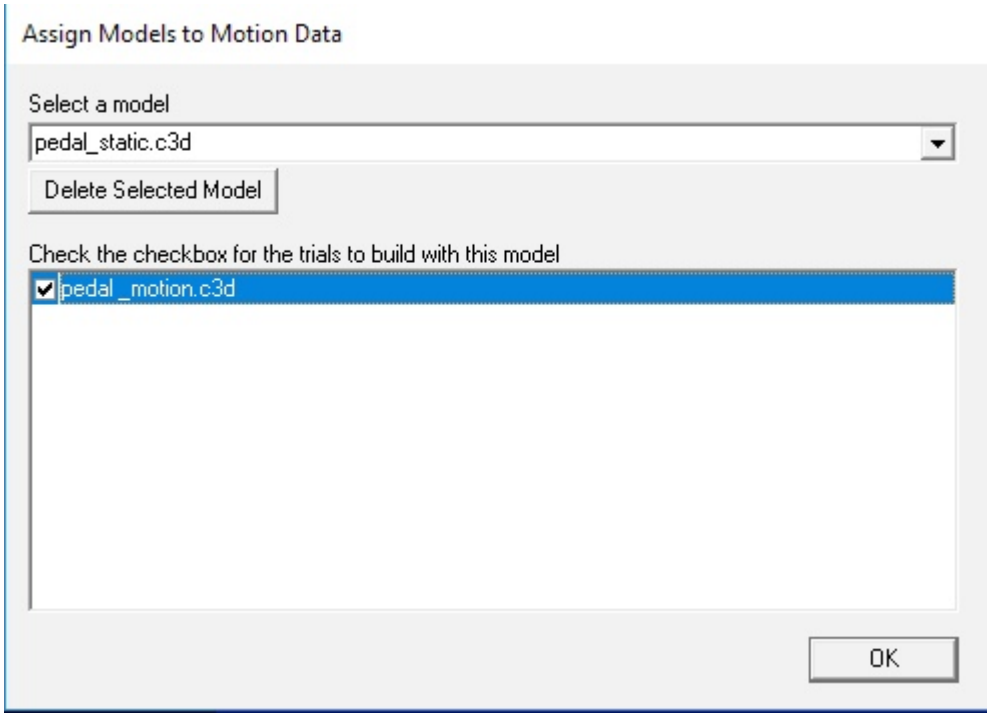

Apply the Model Template

Apply the model template pedal.mdh that was part of the zip file downloaded

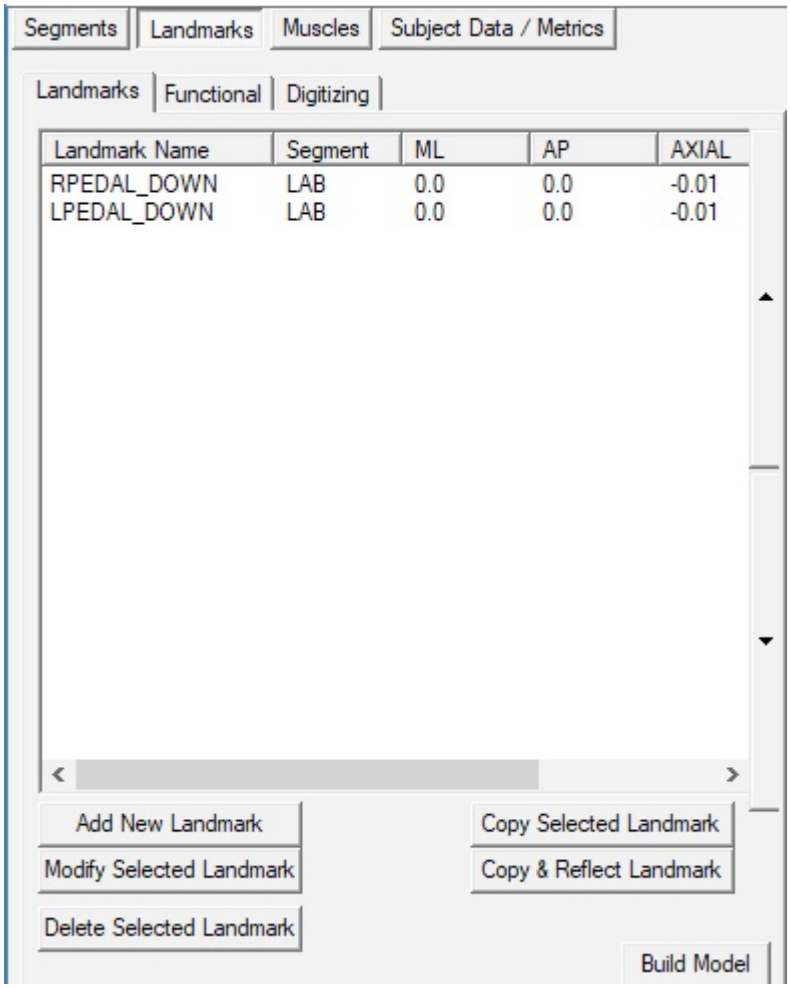
Segments
Landmarks
Muscles
Subject Data / Metrics
Landmarks
Functional
Digitizing
Landmark Name
Segment
ML
AP
AXIAL
RPEDAL_DOWN
LAB
0.0
0.0
-0.01
LPEDAL_DOWN
LAB
0.0
0.0
-0.01
Add New Landmark
Copy Selected Landmark
Modify Selected Landmark
Copy & Reflect Landmark
Delete Selected Landmark
Build Model

Note that there are only two landmarks

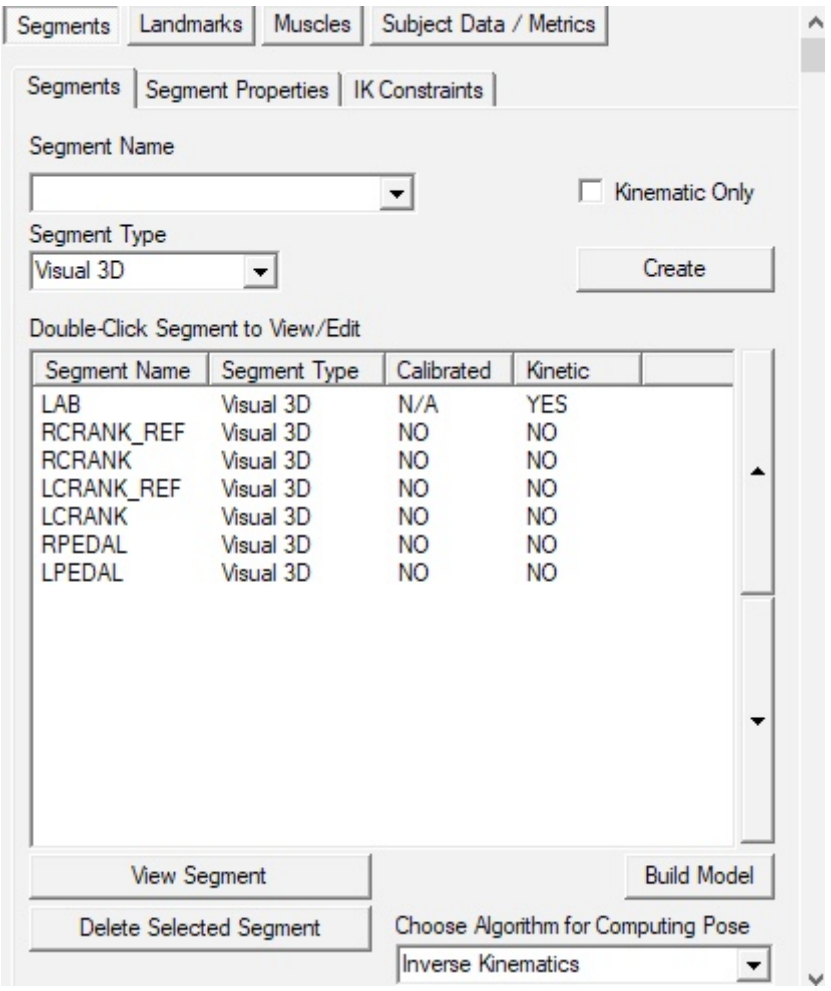

Note that there are 6 segments, but none of them has been built because of missing information.

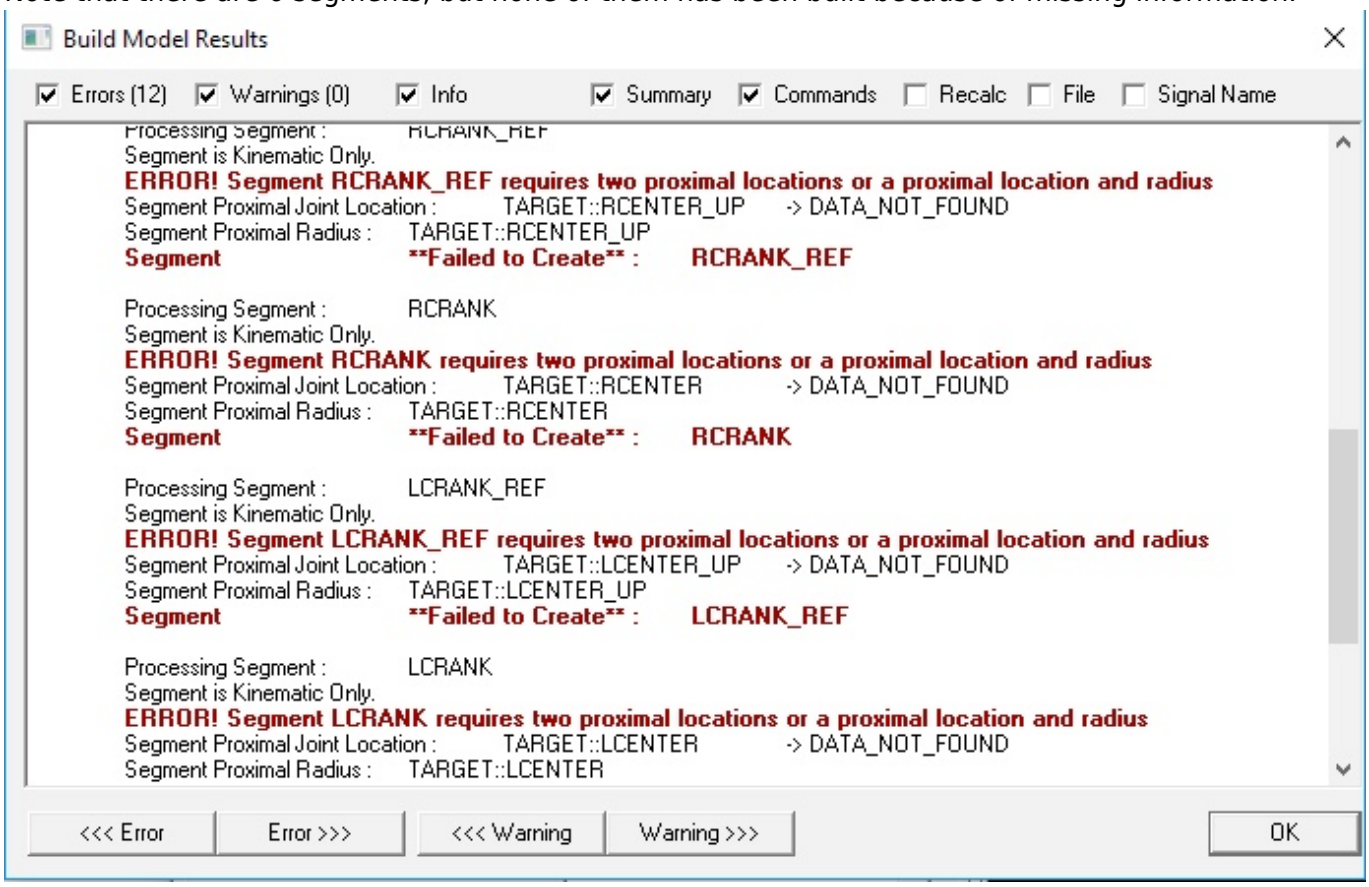

There should be many error messages at this point. We will add in the missing information using

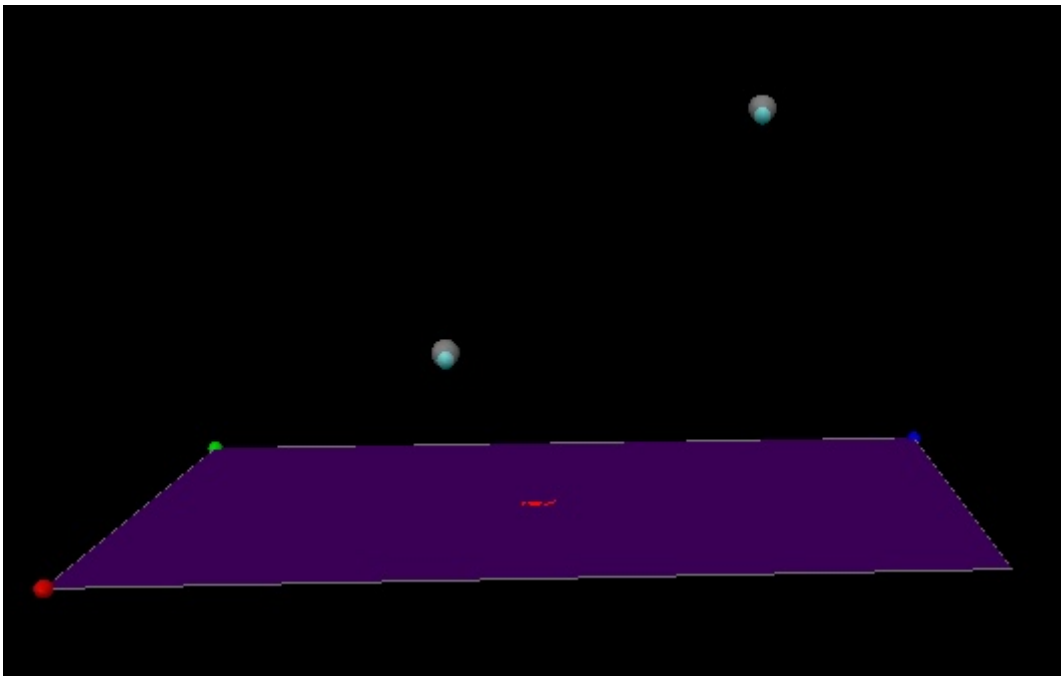

pipeline commands.

Create virtual targets and landmarks

Created virtual targets and landmarks based on the circular path of the markers on the pedals.

The underlying assumptions are that the crank rotates about a fixed axis, the pedals sit at the end of the crank and rotate with the crank axis, but are always oriented vertically.

First, make the movement trial the active file

Second, create TARGETS for the center of the path of each marker and for a marker 0.1 meters along the normal to that path.

Create_Target /SIGNAL_NAMES=RCENTER+RNORMAL+LCENTER+LNORMAL ! /SIGNAL_DESCRIPTION= /EXPRESSION='Best_Fit_Circle(TARGET::ORIGINAL::U1)','Vector(TARGET::ORIGINAL::RCENTER,0)-0.1*Best_Fit_Plane(TARGET::ORIGINAL::U1)','Best_Fit_Circle(TARGET::ORIGINAL::U2)','Vector(TARGET::ORIGINAL::LCENTER,0)-0.1*Best_Fit_Plane(TARGET::ORIGINAL::U2)' ! /INCLUDE_MOTIONFILE=TRUE ! /INCLUDE_CALFILE=FALSE **;** This command uses the Evaluate_Expression function Best_Fit_Circle(TARGET::ORIGINAL::U2) to find the center and radius of a circle that best fits the path of the marker.

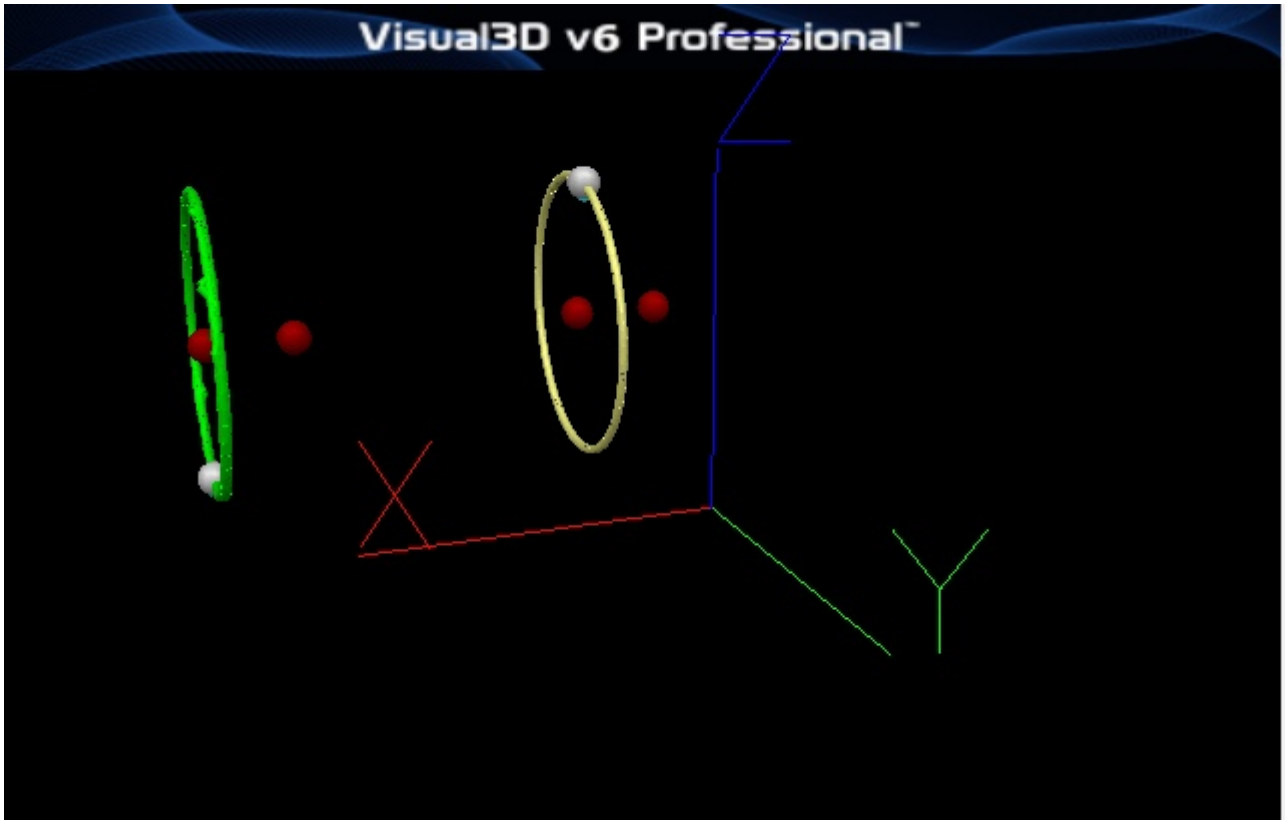

Third, based on the location of these targets in the movement trial, create associated landmarks.

Add_Landmark /LANDMARK_NAME=RCENTER ! /CALIBRATION_FILE= ! /USER_GENERATED=TRUE ! /USE_PERCENTAGE=FALSE ! /CALIBRATION_ONLY=FALSE ! /USE_TARGETS=FALSE /SEGMENT_NAME=LAB ! /TARGET_TYPES= ! /TARGET_NAMES= /MCS_ML=@Eval(Mean(TARGET::ORIGINAL::RCENTER)[1,1]) /MCS_AP=@Eval(Mean(TARGET::ORIGINAL::RCENTER)[1,2]) /MCS_AXIAL=@Eval(Mean(TARGET::ORIGINAL::RCENTER)[1,3]) ! /LANDMARK_LOCATION= ! /REFERENCE_LOCATION_TYPE= ! /REFERENCE_LOCATION_NAME= ! /USE_REFERENCE_LOCATION=FALSE **;** This command takes advantage of the @Eval() function in the pipeline parameters. The command evaluates the expression based on the data in the active movement file, then assigns the values to the Add_Landmark command.

Add_Landmark /LANDMARK_NAME=RNORMAL ! /CALIBRATION_FILE= ! /USER_GENERATED=TRUE ! /USE_PERCENTAGE=FALSE ! /CALIBRATION_ONLY=FALSE ! /USE_TARGETS=FALSE /SEGMENT_NAME=LAB ! /TARGET_TYPES= ! /TARGET_NAMES= /MCS_ML=@Eval(Mean(TARGET::ORIGINAL::RNORMAL)[1,1]) /MCS_AP=@Eval(Mean(TARGET::ORIGINAL::RNORMAL)[1,2]) /MCS_AXIAL=@Eval(Mean(TARGET::ORIGINAL::RNORMAL)[1,3]) ! /LANDMARK_LOCATION= ! /REFERENCE_LOCATION_TYPE= ! /REFERENCE_LOCATION_NAME= ! /USE_REFERENCE_LOCATION=FALSE **; Add_Landmark** /LANDMARK_NAME=RCENTER_UP ! /CALIBRATION_FILE= ! /USER_GENERATED=TRUE ! /USE_PERCENTAGE=FALSE ! /CALIBRATION_ONLY=FALSE ! /USE_TARGETS=FALSE /SEGMENT_NAME=LAB ! /TARGET_TYPES= ! /TARGET_NAMES= /MCS_ML=@Eval(Mean(TARGET::ORIGINAL::RCENTER)[1,1]) /MCS_AP=@Eval(Mean(TARGET::ORIGINAL::RCENTER)[1,2]) /MCS_AXIAL=@Eval(Mean(TARGET::ORIGINAL::RCENTER)[1,3]+0.001) ! /LANDMARK_LOCATION= ! /REFERENCE_LOCATION_TYPE= ! /REFERENCE_LOCATION_NAME= ! /USE_REFERENCE_LOCATION=FALSE **; Add_Landmark** /LANDMARK_NAME=LCENTER ! /CALIBRATION_FILE= ! /USER_GENERATED=TRUE ! /USE_PERCENTAGE=FALSE ! /CALIBRATION_ONLY=FALSE ! /USE_TARGETS=FALSE /SEGMENT_NAME=LAB ! /TARGET_TYPES= !

/TARGET_NAMES= /MCS_ML=@Eval(Mean(TARGET::ORIGINAL::LCENTER)[1,1])
/MCS_AP=@Eval(Mean(TARGET::ORIGINAL::LCENTER)[1,2])
/MCS_AXIAL=@Eval(Mean(TARGET::ORIGINAL::LCENTER)[1,3]) ! /LANDMARK_LOCATION= !
/REFERENCE_LOCATION_TYPE= ! /REFERENCE_LOCATION_NAME= !
/USE_REFERENCE_LOCATION=FALSE **; Add_Landmark** /LANDMARK_NAME=LNORMAL !
/CALIBRATION_FILE= ! /USER_GENERATED=TRUE ! /USE_PERCENTAGE=FALSE !
/CALIBRATION_ONLY=FALSE ! /USE_TARGETS=FALSE /SEGMENT_NAME=LAB ! /TARGET_TYPES= !
/TARGET_NAMES= /MCS_ML=@Eval(Mean(TARGET::ORIGINAL::LNORMAL)[1,1])
/MCS_AP=@Eval(Mean(TARGET::ORIGINAL::LNORMAL)[1,2])
/MCS_AXIAL=@Eval(Mean(TARGET::ORIGINAL::LNORMAL)[1,3]) ! /LANDMARK_LOCATION= !
/REFERENCE_LOCATION_TYPE= ! /REFERENCE_LOCATION_NAME= !
/USE_REFERENCE_LOCATION=FALSE **; Add_Landmark** /LANDMARK_NAME=LCENTER_UP !
/CALIBRATION_FILE= ! /USER_GENERATED=TRUE ! /USE_PERCENTAGE=FALSE !
/CALIBRATION_ONLY=FALSE ! /USE_TARGETS=FALSE /SEGMENT_NAME=LAB ! /TARGET_TYPES= !
/TARGET_NAMES= /MCS_ML=@Eval(Mean(TARGET::ORIGINAL::LCENTER)[1,1])
/MCS_AP=@Eval(Mean(TARGET::ORIGINAL::LCENTER)[1,2])
/MCS_AXIAL=@Eval(Mean(TARGET::ORIGINAL::LCENTER)[1,3]+0.001) ! /LANDMARK_LOCATION= !
/REFERENCE_LOCATION_TYPE= ! /REFERENCE_LOCATION_NAME= !
/USE_REFERENCE_LOCATION=FALSE **;** Lastly Build the Model

Build_Model ! /CALIBRATION_FILE= ! /REBUILD_ALL_MODELS=FALSE ! /DISPLAY_RESULTS=TRUE **;**
The resulting model and movement trial are:

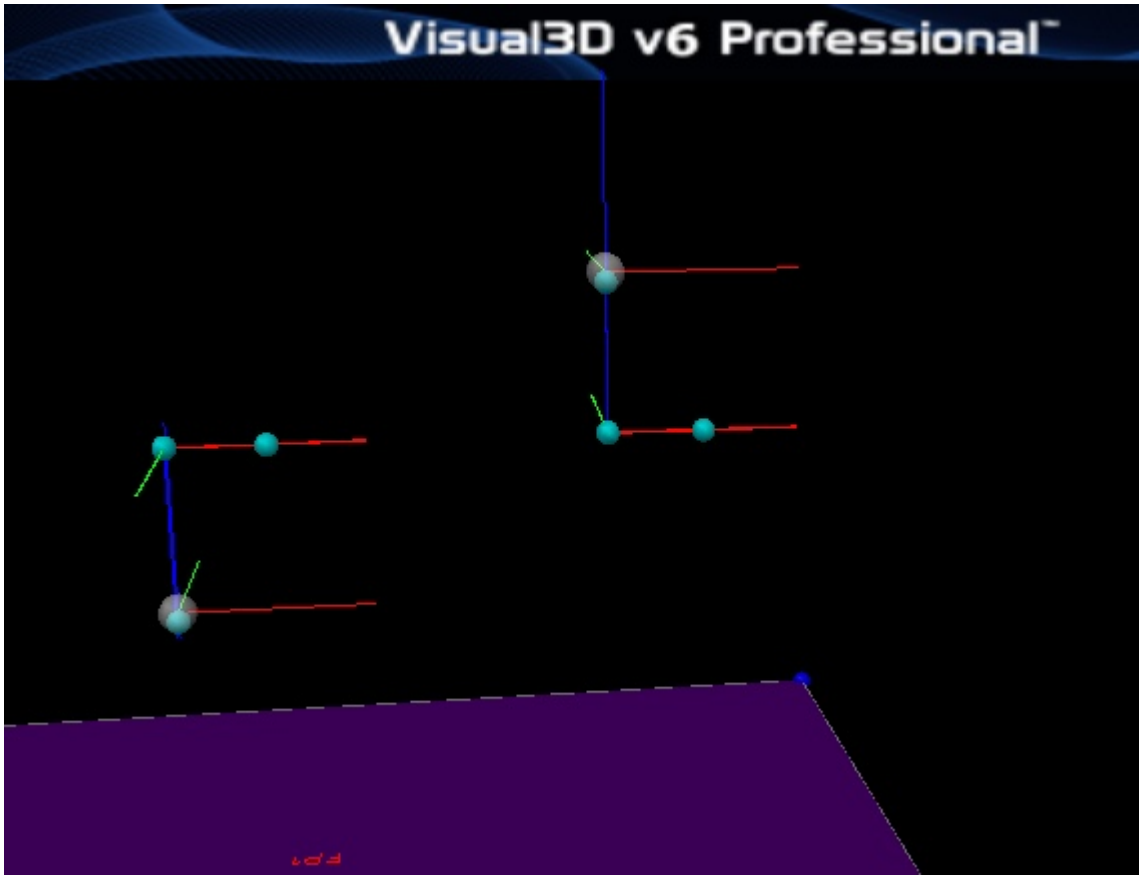

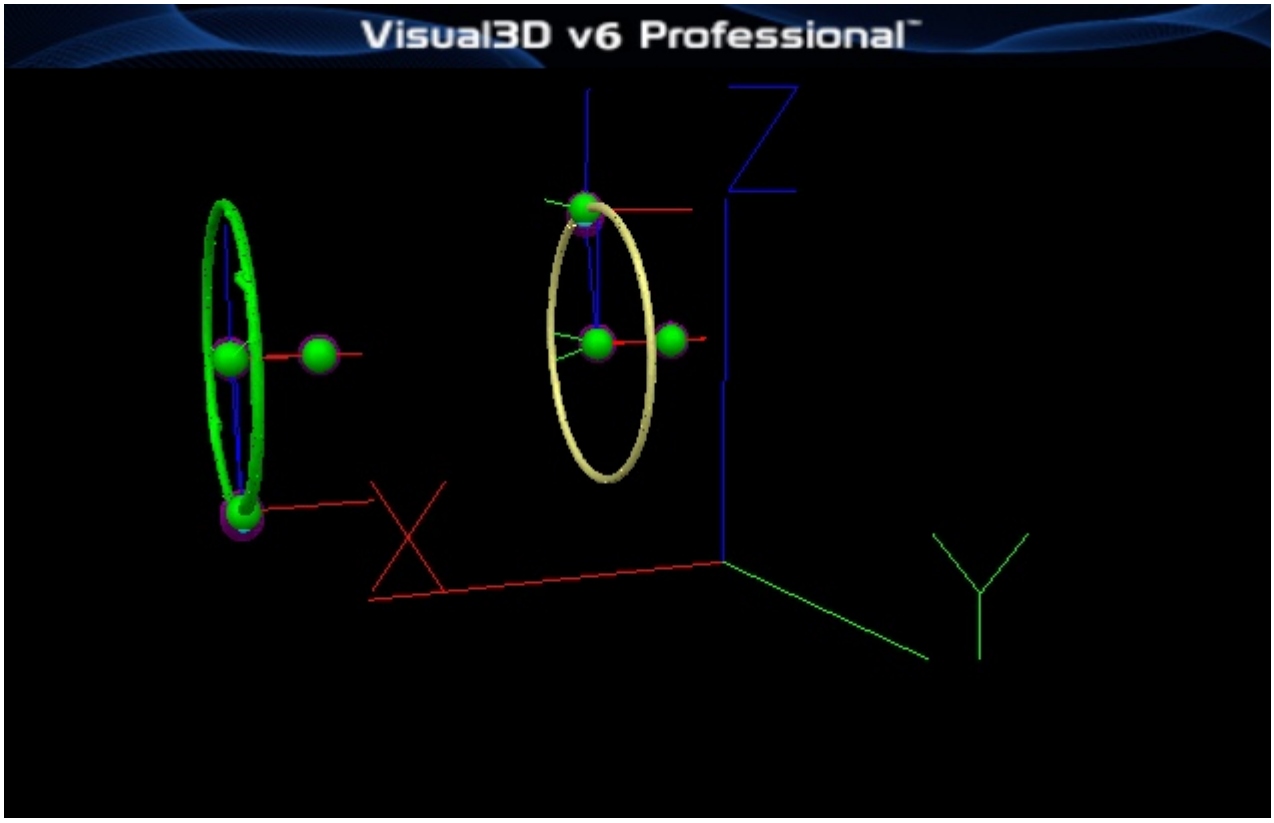

Modeling Details

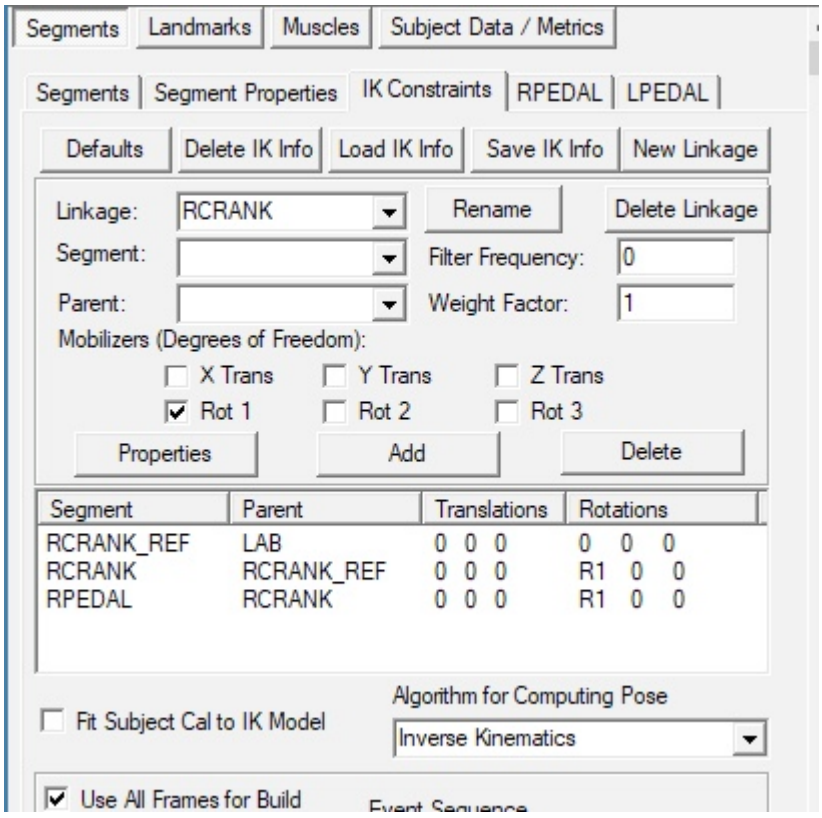

Two IK chains were constructed, one for each pedal. Note that the root segment of the chain has all translations and rotations constrained. The problem is that we don't want the pedal constrained to the LAB, but to the location of the marker on the pedal. We specified this using Motion Constraints. Selected the Properties Tab

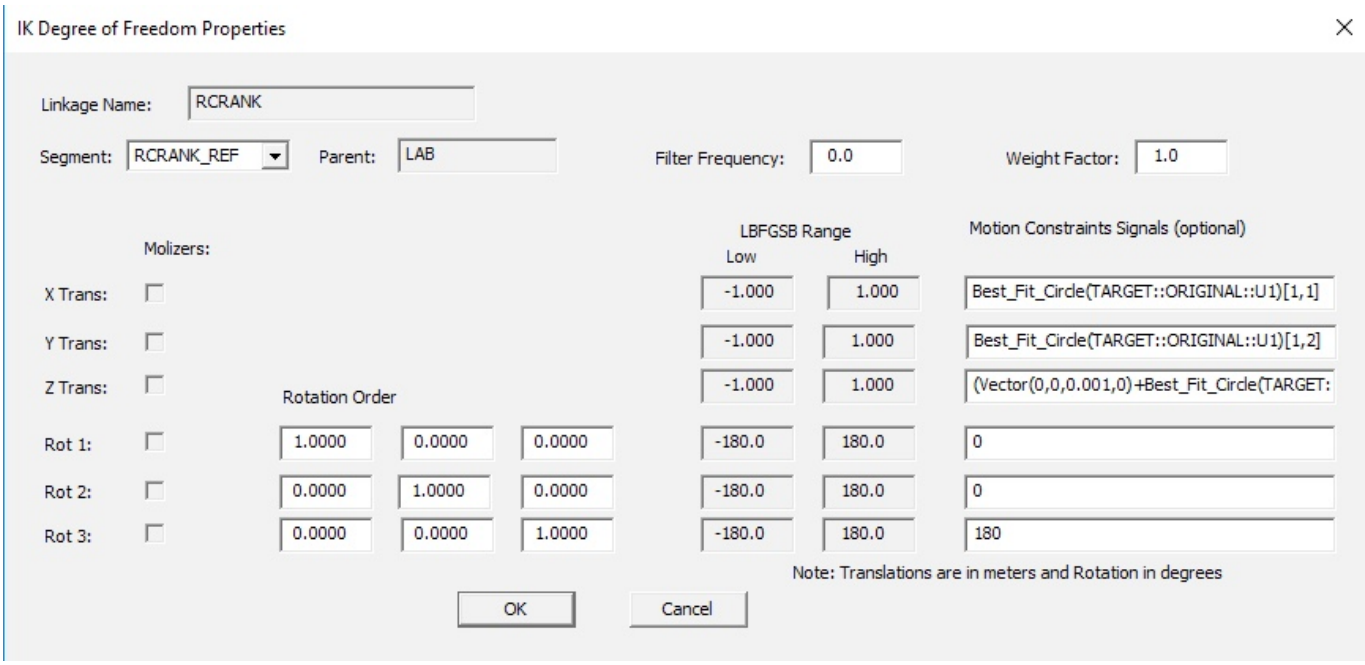

The origin of the reference for the crank is placed just above the center of the marker path and rotated 180 degrees about the vertical axis of the lab.

The crank and pedal are then given one degree of freedom about the X-axis, and one tracking marker.

From:
https://has-motion.com/wiki/ - **Wiki Documentation Site**

Permanent link:
https://has-motion.com/wiki/doku.php?id=visual3d:tutorials:modeling:bicycle_pedal_and_crank&rev=1721229111

Last update: **2024/07/17 15:11**